Service Bulletin

Mazda North American Operations Irvine, CA 92718-2906



Category	Applicable Model/s	Subject	Bulletin No.	005/98
S (08)	See Below	SEAT BELT EXTENDERS	Issued	04/22/98
			Revised	08/05/98

BULLETIN REVISION NOTE

The PART(S) INFORMATION section of this bulletin has been corrected and revised to include 1999 models.

AFFECTED MODELS

See Parts Information

DESCRIPTION

If a fully extended seat belt will not reach across the lap of the vehicle occupant, a seat belt extender may be available which can lengthened a seat belt by 8, 9 or 12 inches. Refer to the Parts Information on page two for applicable models and available lengths.


The following "Warning Label" is affixed to the seat belt extender. The proper usage and safety related warnings listed on the extender must be explained to the customer when the extender is delivered.

LAP BELT EXTENDER

NEVER USE:

- When tap strap will not adjust snugly to hips.
- When intersection of lap and upper torso straps (measured along the lap strap) is less than 6 inches from an imaginary center line of occupant's body.

NAVAJO and B-SERIES

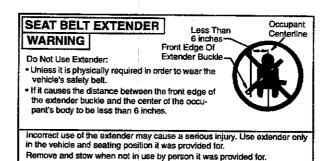

ALL OTHER MODELS

It is also the dealer's responsibility to explain the following Owners Manual warning information to the customer: Warning

- Using a seat belt extender when not necessary is dangerous. The seat belt will be too long and not
 fit properly. In an accident, the seat belt will not provide adequate protection and you (customer)
 could be seriously injured. Only use the extender when it is required to fasten the seat belt properly.
- Using an extender that is too long is dangerous. The seat belt will not fit properly. In an accident, the seat belt will not provide adequate protection and you could be seriously injured. Do not use the seat belt extender or choose one shorter in length if the distance between the extender's buckle and the center of the user's body is less than 6 inches.
- Using a seat belt extender that is for another person or a different vehicle or seat is dangerous. The
 seat belt will not provide adequate protection and the user can be seriously injured in an accident.
 Only use the extender provided for you and for the particular vehicle and seat. Never use an extender in a different vehicle or seat.

PARTS INFORMATION

(See table on page two.)

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools / equipment and take training to correctly and safety maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine it the information applies, customers should contact their nearest authorized Mazda dealership.

Number: 005/98	Date Issued: 04/22/98	Revised:08/05/98	

PARTS INFORMATION - Seat Belt Extender Availability/Application NOTE: It is the dealer's responsibility to explain to the customer that the extender should be used only at the designated seat position(s) as shown above. 97-98 PROTEGE 95-99 MILLENIA 93-97 626/MX-6 95 PROTEGE 94-97 B-SERIES 91-94 NAVAJO 1999 PROTEGE 91-94 NAVAJO 96 PROTEGE 98 B-SERIES 94-97 MIATA 94-95 MX-3 96-98 MPV AdW 06-68 93-95 MPV 91-92 MPV 93-95 HX-7 Yr./Model 88-89 929 98-99 626 99 MIATA 92-95 929 (bright, side release buckle) JM1BB14**T0300001-T0349419 JM1BB14**T0349420 (black buckle) AL ≦ ALL A Ł AL. ≧ ₽ ≥ ≧ ≥ .≧ ≧ ≥ ≗ ≗ front seat × × × × × × × IL × 2 pass. × エコ bench seat × × × # -2nd seat Seat Position × ∌⊣c × × × × II × × × separate seat 포 × × Ir bench seat 3rd seat pass ∌⊣c エヌ × 8 inch Extender ZZL1-57-660A ZZL1-57-660A ZZL0-57-660 ZZL0-57-660 ì 1 1 i í ł ì i i į į ļ ž 9 Inch Extender GDYC-57-63X GDYA-57-63X BEYH-57-63X BEYH-57-63X BCYM-57-63X BCYM-57-63X LBY8-57-63X FDY5-57-63X BJYE-57-63X LBY4-57-63X FDY5-57-63X LBY2-57-63X FDY5-57-63X LBY2-57-63X FDY5-57-63X FDY5-57-63X LBY6-57-63X LBY2-57-63X LBY6-57-63X LBY4-57-63X LBY2-57-63X LBY8-57-63X LBY4-57-63X LBY2-57-63X LBY2-57-63X LBY2-57-63X Part Number i 12 inch Extende BCYN-57-63X BCYN-57-63X GDYD-57-63X GDYB-57-63X FDY6-57-63X FDY6-57-63X BEYJ-57-63X BEYJ-57-63X LBY7-57-63X LBY7-57-63X LBY5-57-63X LBY3-57-63X LBY9-57-63X LBY5-57-63X LBY3-57-63X LBY9-57-63X LBY5-57-63X LYB3-57-63X FDY6-57-63X BJYF-67-63X LBY3-57-63X LBY3-57-63X FDY6-57-63X LBY3-57-63X FDY6-57-63X LB3-57-63X

Number: 005/98	Date Issued: 04/22/98	Revised:08/05/98	
WARRANTY INFORMATION			
107			

Warranty Type	A	
Symptom Code	99	
Damage Code	99	·····
Part Number Main Cause	Refer to Parts Information	
Quantity	1	
Operation Number	N/A	······································
Labor Hours	N/A	